



SERVICE BULLETIN
#LO-006

RE: Rear Receiver

OVERVIEW: This Service Bulletin covers the inspection and bracing of the rear receiver.

MODELS: Little Guy Max & Little Guy Mini Max.

PROBLEM: It is possible for the rear receiver weld to break or bend due to rust or corrosion at the attachment point.

CORRECTION: Additional piece(s) can be welded onto the chassis to better support the receiver rack and prevent failure.

WHAT TO USE: N/A

SUMMARY: The issue does not appear to be widespread but has occurred a few times. As the chassis weathers it becomes more of a possibility. The possible affected VIN range of Max and Mini Max trailers is 566006-566609 and 000001-000821. When the first issue arose, the chassis manufacturer added an extra support tube (pictures below), you can look underneath your trailer to verify if a support was added. Call your local Liberty Outdoors dealer to arrange an appointment to have your trailer inspected and have the rear receiver reinforced.

NOTE: See pictures on page 2 of the reinforcement that can be added.

Please contact us with any questions, concerns or comments:

Warranty Line: 814-444-6679

- warranty@golibertyoutdoors.com
- parts@golibertyoutdoors.com

Technical Service: 814-485-2977

- ts@golibertyoutdoors.com

Factory Main Line: 814-444-1001

Corporate Sales Office: 877-545-4897

- support@golibertyoutdoors.com

Sincerely,


Liberty Outdoors, LLC



**LIBERTY
OUTDOORS**



Broken weld on 2nd C channel in from rear bumper

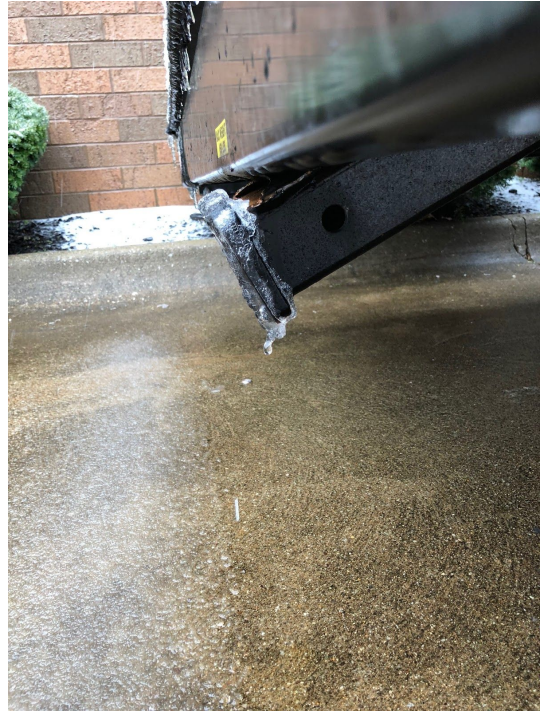

Broken weld forces receiver to bend



**New reinforcement tube welded into C channel for extra support
*This is not the only way to support it, the dealer can support it in a variety of ways**